



2017 Honda CR-V LX

Pre-Purchase Inspection

Standard Package

FINAL ASSESSMENT

Excellent

Condition summary based on the LemonFreeAuto inspection, OBD-II scan, body, interior, mechanical checks, and road test observations.

EXCELLENT



★★★★★ 5.0

INSPECTION PERFORMED
BY

Luke Shannon

5 ratings · 29
inspections



INSPECTION
SUMMARY

MECHANICAL
Excellent

BODY & PAINT
Excellent

INTERIOR
Excellent


REPAIRS NEEDED
None needed

INSPECTION PHOTOS & VIDEOS




CLICK TO VIEW PHOTOS

All Inspection Photos
28 inspection photos

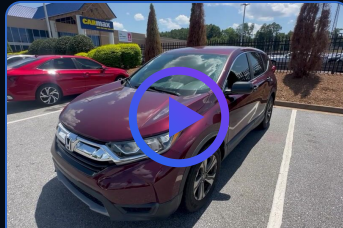

CLICK TO PLAY VIDEO

Vehicle Walkaround
Watch video

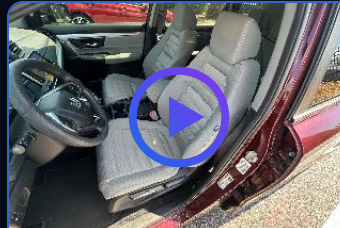

CLICK TO PLAY VIDEO

Interior Video
Watch video



CLICK TO PLAY VIDEO

Test Drive Video
Watch video

AI-TARGETED COMMON FAILURE POINTS

✓ ALL CHECKED

AUXILIARY SYSTEMS

A/C Compressor Clutch Failure

✓ INSPECTOR ASSESSED

ELECTRICAL SYSTEMS

Infotainment System Freezing

✓ INSPECTOR ASSESSED

DRIVE LINE

Rear Differential Fluid Leaks (AWD)

✓ INSPECTOR ASSESSED

UNDERCARRIAGE

Front Brake Pad Wear

✓ INSPECTOR ASSESSED

UNDERCARRIAGE

Tire Cupping and Uneven Wear

✓ INSPECTOR ASSESSED

TRANSMISSION

CVT Transmission Fluid Condition

✓ INSPECTOR ASSESSED

OBD-II SCAN SUMMARY

NO CODES REPORTED

CODES PRESENT
No

TOTAL CODES
0

SMOG READY
Yes

MILES SINCE CLEARED
5,687 mi

CHECK ENGINE LIGHT
No

VEHICLE INFORMATION

Year	2017	Make	Honda
Model	CR-V	Trim	LX
VIN	7FARW5H3XHE006150	Odometer	49,878 mi
Engine	4-Cylinder	Drivetrain	FWD

AI-TARGETED COMMON FAILURE POINTS

LemonFreeAuto's AI model evaluated this vehicle against model-specific known issues, TSB-style concerns, high-wear patterns, and inspection tips before the final review. The inspector then checked each AI-targeted area during the inspection.

6

AI-SCREENED AREAS

6

INSPECTOR ADDRESSED

6

NO CONCERN FOUND

0

NEEDS ATTENTION

A/C Compressor Clutch Failure

Inspector checked

Test A/C operation under load; compressor clutch assemblies fail prematurely causing no cooling. Listen for unusual noises from compressor area and verify clutch engagement.

INSPECTOR RESULT: CLEAR

Finding: Known issue checked - no concern found

Infotainment System Freezing

Inspector checked

Cycle through all infotainment functions including backup camera, Bluetooth, and touchscreen responsiveness. System lockups and slow response are common, may require software update or unit replacement.

INSPECTOR RESULT: CLEAR

Finding: Known issue checked - no concern found

Rear Differential Fluid Leaks (AWD)

Inspector checked

If AWD-equipped, check rear differential housing and seals for fluid seepage. Leaks develop at pinion seal and axle seals, leaving visible residue on housing.

INSPECTOR RESULT: CLEAR

Finding: Known issue checked - no concern found

Inspector checked

INSPECTOR RESULT: CLEAR

 Inspector checked

INSPECTOR RESULT: CLEAR

 Inspector checked

INSPECTOR RESULT: CLEAR

OBD-II SCAN RESULTS

ACTIVE CODES

PENDING CODES

STORED CODES

ENHANCED CODES (ABS / AIRBAG / TRANS)

RECOMMENDED REPAIRS (IF APPLICABLE)

No repairs needed.

EMISSIONS READINESS MONITORS

Overall

Ready

Catalyst: Ready

EVAP: Ready

O2 Sensor: Ready

O2 Heater: Ready

EGR: N/A

Misfire: Ready

Fuel Sys: Ready

Comp Comp: Ready

Heated Cat: N/A


Secondary Air: N/A

A/C Refrig: N/A

Smog / Readiness Notes

Smog Readiness Check Passed. Check Engine Light OFF. 0 Confirmed Trouble Codes. 0 Pending Trouble Codes. EGR and/or VVT System shows as Unknown until check performed.

EXTERIOR BODY & PAINT

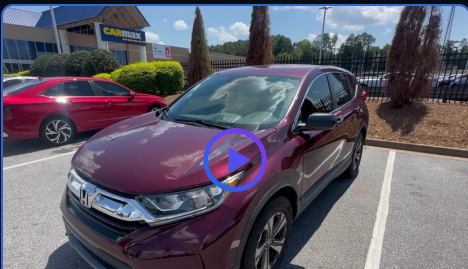

CLICK TO PLAY VIDEO

Vehicle Walkaround Video



Click to enlarge

Photo 1



Click to enlarge

Photo 2



Click to enlarge

Photo 3



Click to enlarge

Photo 4



Click to enlarge

Photo 5




Click to enlarge

Photo 6



Click to enlarge

Photo 7

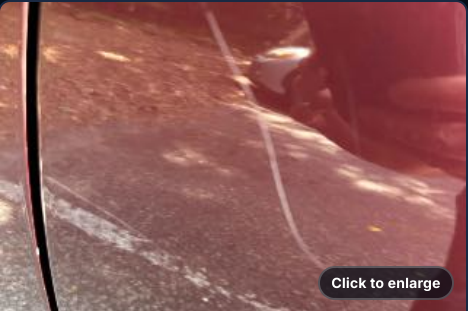

Click to enlarge

Photo 8

Rust

None detected

Body Work

Minor repairs

Doors (L)	Good	Doors (R)	Excellent
Fenders (L)	Excellent	Fenders (R)	Excellent
Front Bumper	Excellent	Hood	Excellent
Rear Bumper	Excellent	Rear Glass	Excellent
Roof	Excellent	Side Glass	Excellent
Trunk/Hatch	Excellent	Windshield	Excellent

Exterior Notes

Driver's door sticks a little bit as it opens and closes. This indicates prior bodywork and potentially the need for an adjustment of the hinges or latches.

TIRES & WHEELS



Photo 9



Photo 10

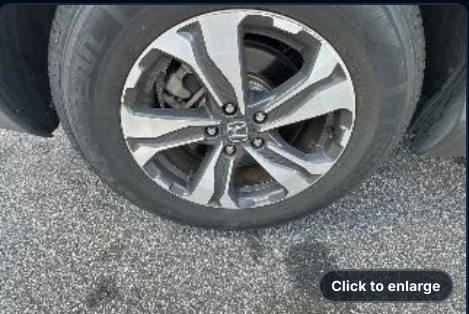


Photo 11



Photo 12

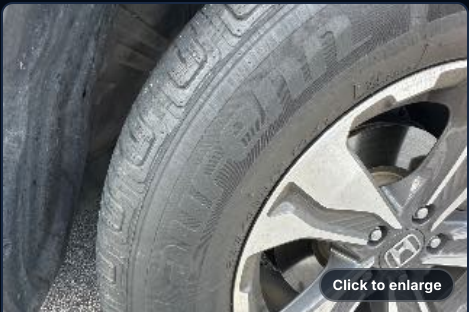


Photo 13

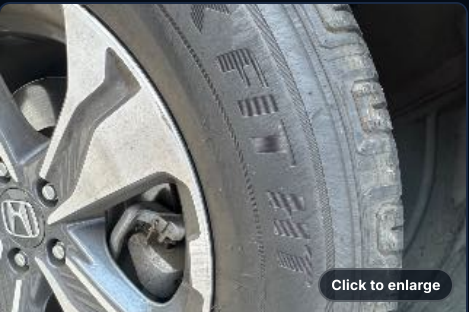


Photo 14

Brand	Michelin Defender	Size	245/55/r17
Tires Match	Yes - all matching	Spare	Full-size spare

FL TREAD	FR TREAD	RL TREAD	RR TREAD
11/32"	12/32"	11/32"	12/32"

Wheel Condition	Excellent
-----------------	-----------

ENGINE & POWERTRAIN



Photo 1



Photo 2



Photo 3

Engine Oil Level	Excellent	Engine Oil Condition	Excellent
Coolant Level	Fair	Coolant Condition	Excellent
Transmission Fluid Level	Excellent	Transmission Fluid Condition	Excellent
Evidence of Leaks	None observed	Brake Fluid	Excellent
Power Steering Fluid	Excellent	Exhaust System	Excellent
Belts & Hoses	Excellent	Battery Condition	Excellent

Inspector Notes

Although the coolant looked fine, the coolant level was low. This indicates a potential leak, although no obvious leaks were observed at the time of the inspection.

UNDERCARRIAGE

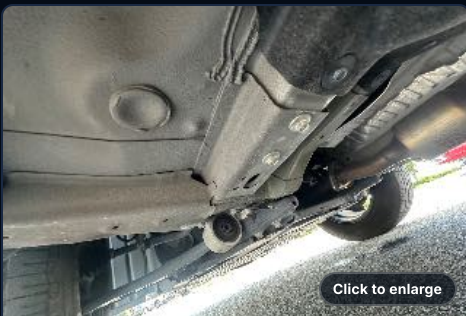


Photo 1

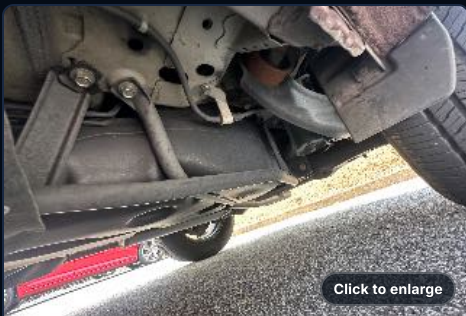


Photo 2


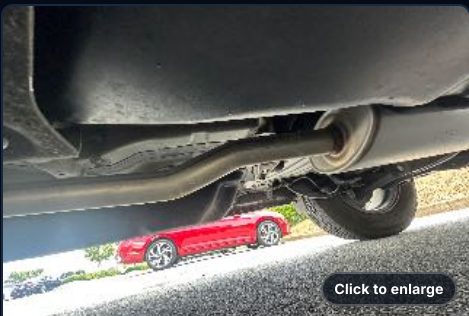


Photo 3

Fluid Leaks	None detected	Frame Damage	None - appears original
-------------	---------------	--------------	-------------------------

Differential	Excellent	Exhaust (underside)	Excellent
Floor Pans	Excellent	Fuel Tank/Lines	Excellent
Oil Pan	Excellent	Transmission Pan	Excellent
Undercarriage Notes			
Frame Rust: None			

INTERIOR

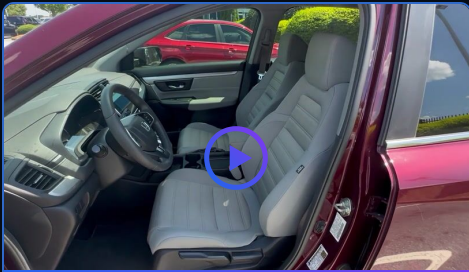


CLICK TO PLAY VIDEO

Interior Video



Click to enlarge

Photo 1

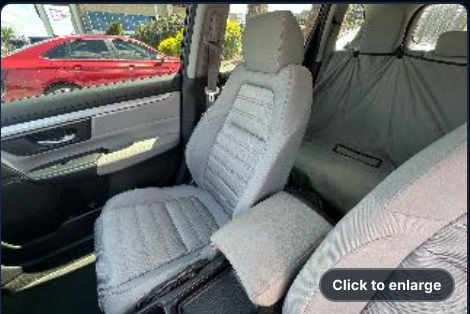

Click to enlarge

Photo 2



Click to enlarge

Photo 3



Click to enlarge

Photo 4



Click to enlarge

Photo 5



Click to enlarge

Photo 6



Click to enlarge

Photo 7



Click to enlarge

Photo 8

Odors

Clean/neutral

Carpet/Floor Mats	Good	Center Console	Excellent
Dashboard	Excellent	Door Panels	Excellent
Driver Seat	Excellent	Headliner	Excellent
Passenger Seat	Excellent	Rear Seats	Excellent
Steering Wheel	Excellent	Trunk/Cargo Area	Excellent

Interior Notes

Interior is very clean no bad odors, however, there's a lot of pet hair and a deep vacuum or cleaning will be needed.

ELECTRICAL & LIGHTS

Backup Camera	Excellent	Brake Lights	Good
Dashboard Lights	Excellent	Fog Lights	Excellent
Headlights (high)	Excellent	Headlights (low)	Excellent
Horn	Excellent	Infotainment System	Excellent
Interior Lights	Excellent	Power Locks	Excellent
Power Mirrors	Excellent	Power Windows	Excellent
Reverse Lights	Excellent	Tail Lights	Excellent
Turn Signals	Excellent	Hazard Lights	Excellent

Inspector Notes

The third brake light is out (This is the brake light that's in the middle at the top of the rear hatch).

TEST DRIVE



CLICK TO PLAY TEST DRIVE VIDEO

Watch full test drive video

Distance	5 mi	Warning Lights	None
Unusual Noises	None	Vibrations	None

No component ratings recorded for this section.

Test Drive Notes

Test drive camera setup: mounted Yes.

Planned test drive distance: 5 or less miles.

BRAKE SYSTEM

EST FRONT PAD LIFE 40%		EST REAR PAD LIFE 60%	
ABS System	Excellent	Brake Pedal Feel	Excellent
Brake Warning Lights	Excellent	Front Rotors	Excellent
Parking Brake	Excellent	Rear Rotors	Excellent

SUSPENSION & STEERING

Front Struts/Shocks	Excellent	Front Suspension Components	Excellent
Power Steering System	Excellent	Rear Struts/Shocks	Excellent
Rear Suspension Components	Excellent	Steering Rack, Lines & Hoses	Excellent

FINAL ASSESSMENT



Excellent

Final inspection report summary based on inspection observations, diagnostics, and road test notes.

MECHANICAL Excellent	BODY & PAINT Excellent	INTERIOR Excellent	REPAIRS NEEDED None needed
-------------------------	---------------------------	-----------------------	-------------------------------



Inspector Audio Summary

Luke Shannon · 0:52



Hear the inspector's
overall take

VEHICLE HISTORY REPORT

Full Car Simulcast vehicle history is attached as the following report pages. Source PDF: [open vehicle history](#) · carfax

LemonFreeAuto, Inc. · AI-native mobile pre-purchase inspections.

This report reflects the inspector's observations at the time of inspection. Conditions may change. See our Terms at [lemonfreeauto.com/terms](#).

Booking LFA-9BF11F · Inspector Luke Shannon · Generated 2026-08-04T15:02:59.169Z



Report

US \$44.99

2017 Honda CR-V LX

44,986 mi | VIN: 7FARW5H3XHE006150 |

4 Door Wagon/Sport Utility | 2.4L I4 F DOHC 16V | Gasoline | Front wheel drive

CARFAX HAS THE MOST
ACCIDENT & DAMAGE
INFORMATION



ACCIDENT



Minor to Moderate Damage



CARFAX VALUE

\$18,790

GOOD RELIABILITY



10 Service History Records



2 Previous Owners



Personal Vehicle



Last Owned in South Carolina



24 Detailed Records Available

This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 5/24/26 at 11:05:00 AM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.



Accident / Damage History

Not all accidents / issues are reported to CARFAX


Event 1

05/29/2020

Accident reported: minor to moderate damage

- Vehicle involved in a sideswipe collision with another motor vehicle
- Airbags did not deploy

Damage Severity Scale

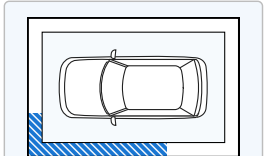

History-Based Value Report

\$18,790

CARFAX Retail Value

History events affecting this vehicle's value



Service History



Personal Vehicle



Accident Reported



Reliability Forecast

Based on 2017 Honda CR-V LX with similar mileage

3-Year Reliability Forecast



Good news! This vehicle is expected to have average risk of repair and average repair costs.



What makes this vehicle have **good** reliability?

- Top 50%** compared to similar vehicles
- Average Repair Cost**
\$400 avg per year
- Oil Changes** performed regularly
- Average Likelihood of Repair**

Additional History Not all accidents / issues are reported to CARFAX	Owner 1	Owner 2
Total Loss No total loss reported to CARFAX.	No Issues Reported	No Issues Reported
Structural Damage CARFAX recommends that you have this vehicle inspected by a collision repair specialist.	No Issues Reported	No Issues Reported
Airbag Deployment No airbag deployment reported to CARFAX.	No Issues Reported	No Issues Reported
Odometer Check No indication of an odometer rollback.	No Issues Indicated	No Issues Indicated
Accident / Damage Accident reported: 05/29/2020.	Accident Reported	No New Issues Reported
Manufacturer Recall No open recalls reported to CARFAX.	No Recalls Reported	No Recalls Reported
Basic Warranty Original warranty estimated to have expired.	Warranty Expired	Warranty Expired

Title History CARFAX guarantees the information in this section	Owner 1	Owner 2
Damage Brands Salvage Junk Rebuilt Fire Flood Hail Lemon	Guaranteed No Problem	Guaranteed No Problem
Odometer Brands Not Actual Mileage Exceeds Mechanical Limits	Guaranteed No Problem	Guaranteed No Problem
GUARANTEED - None of these title problems were reported by a U.S. state Department of Motor Vehicles (DMV). If you find that any of these title problems were reported by a DMV and not included in this report, you may qualify. View Terms View Certificate		

Ownership History The number of owners is estimated	Owner 1	Owner 2
Year purchased	2017	2026
Type of owner	Personal	Personal
Estimated length of ownership	8 yrs. 6 mo.	4 months
Owned in the following states/provinces	Florida	South Carolina
Estimated miles driven per year	6,024/yr	---
Last reported odometer reading	42,213	44,986

Detailed History

**Owner 1**

Purchased: 2017

Low mileage! This owner drove less than the industry average of 15,000 miles per year.

Personal Vehicle
6,024 mi/yr

Date	Mileage	Source	Comments
06/09/2017	4	Coggin Honda of Orlando Orlando, FL 407-850-3649 cogginhondaorlando.com ★ 4.6 / 5.0 1,281 Verified Reviews ♥ 533 Customer Favorites	Vehicle offered for sale
06/09/2017		Coggin Honda of Orlando Orlando, FL 855-433-7523 cogginhondaorlando.com ★ 4.6 / 5.0 1,281 Verified Reviews ♥ 533 Customer Favorites	 Vehicle serviced - Pre-delivery inspection completed - Vehicle washed/detailed
06/27/2017		Coggin Honda of Orlando Orlando, FL 855-433-7523 cogginhondaorlando.com ★ 4.6 / 5.0 1,281 Verified Reviews ♥ 533 Customer Favorites	 Vehicle serviced - Window tint installed - Vehicle washed/detailed
06/27/2017	5	Florida Motor Vehicle Dept.	Vehicle purchase reported - Titled or registered as personal vehicle
07/05/2017		Florida Motor Vehicle Dept. Orlando, FL Title #0127806935	Title issued or updated - Registration issued or renewed - First owner reported - Titled or registered as personal vehicle - Loan or lien reported - Vehicle color noted as Red
08/11/2017		Florida Motor Vehicle Dept. Orlando, FL Title #0127806935	Title issued or updated - Titled or registered as personal vehicle - Loan or lien reported - Vehicle color noted as Red
04/26/2018		Florida Motor Vehicle Dept. Orlando, FL Title #0127806935	Registration issued or renewed - Titled or registered as personal vehicle - Loan or lien reported - Vehicle color noted as Red
02/20/2019	13,651	Coggin Honda of Orlando Orlando, FL 855-433-7523 cogginhondaorlando.com ★ 4.6 / 5.0 1,281 Verified Reviews ♥ 533 Customer Favorites	 Vehicle serviced - Battery/charging system checked - Tires rotated - Vehicle washed/detailed
04/30/2019		Florida Motor Vehicle Dept. Orlando, FL Title #0127806935	Registration issued or renewed - Titled or registered as personal vehicle - Loan or lien reported - Vehicle color noted as Red
06/17/2019	15,434	Coggin Honda of Orlando Orlando, FL 855-433-7523 cogginhondaorlando.com ★ 4.6 / 5.0 1,281 Verified Reviews ♥ 533 Customer Favorites	 Vehicle serviced - Battery/charging system checked - Vehicle washed/detailed
01/08/2020	19,401	Coggin Honda of Orlando Orlando, FL 855-433-7523 cogginhondaorlando.com	 Vehicle serviced - Maintenance inspection completed - Battery/charging system checked - Four tires balanced - Four wheel alignment performed

★ 4.6 / 5.0 1,281 Verified Reviews
♥ 533 Customer Favorites

- Oil and filter changed
- One tire balanced
- One tire mounted
- Tire repaired
- Tires rotated
- Vehicle washed/detailed

04/30/2020

Florida
Motor Vehicle Dept.
Orlando, FL
Title #0127806935

Registration issued or renewed

- Titled or registered as personal vehicle
- Loan or lien reported
- Vehicle color noted as Red

05/29/2020

Damage Report




Accident reported: minor to moderate damage

- Vehicle involved in a sideswipe collision with another motor vehicle
- Damage to left side
- Damage to left front
- Airbags did not deploy

Damage Severity Scale



Damage Location

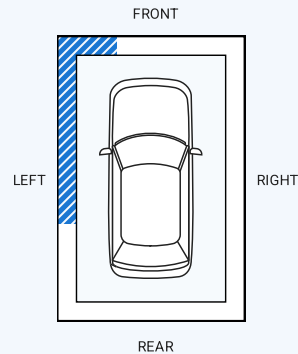

**CARFAX HAS THE MOST
ACCIDENT & DAMAGE
INFORMATION**

06/24/2020

21,260

Coggin Honda of Orlando
Orlando, FL
855-433-7523
cogginhondaorlando.com

★ 4.6 / 5.0 1,281 Verified Reviews
♥ 533 Customer Favorites



Vehicle serviced

- Battery/charging system checked
- Battery replaced
- Vehicle washed/detailed

05/03/2021

Florida
Motor Vehicle Dept.
Orlando, FL
Title #0127806935

Registration issued or renewed

- Titled or registered as personal vehicle
- Loan or lien reported
- Vehicle color noted as Red

08/18/2022

34,808

Fast Lane Automotive
Orlando, FL
321-236-9336
fastlaneautomotive.net/

★ 4.8 / 5.0 200 Verified Reviews
♥ 38 Customer Favorites



Vehicle serviced

- Oil and filter changed

11/17/2022

35,863

Fast Lane Automotive
Orlando, FL
321-236-9336
fastlaneautomotive.net/

★ 4.8 / 5.0 200 Verified Reviews
♥ 38 Customer Favorites



Vehicle serviced

- Brake fluid checked
- Brake fluid flushed/changed

03/13/2023

Florida
Motor Vehicle Dept.
Orlando, FL

Registration issued or renewed

- Titled or registered as personal vehicle
- Vehicle color noted as Red

Title #0127806935			
05/01/2023		Florida Motor Vehicle Dept. Orlando, FL Title #0127806935	Registration issued or renewed - Titled or registered as personal vehicle - Vehicle color noted as Red
06/27/2024	42,213	Tire Choice Auto Service Centers Orlando, FL 407-434-0768 thetirechoice.com ★ 4.8 / 5.0 63 Verified Reviews ♥ 4 Customer Favorites	 Vehicle serviced - Battery/charging system checked - Brakes checked - Brakes serviced - Oil and filter changed - Tires rotated
05/05/2025		Florida Motor Vehicle Dept. Orlando, FL Title #0127806935	Registration issued or renewed - Titled or registered as personal vehicle - Vehicle color noted as Red
05/14/2025		Take 5 Oil Change Orlando, FL (407) 250-6571 https://www.take5.com/ ★ 4.5 / 5.0 220 Verified Reviews ♥ 1,857 Customer Favorites	 Vehicle serviced - Oil and filter changed



Owner 2
Purchased: 2026

Personal Vehicle

Date	Mileage	Source	Comments
01/19/2026		South Carolina Motor Vehicle Dept.	Vehicle purchase reported
01/29/2026	44,986	South Carolina Motor Vehicle Dept. Greenville, SC Title #772060501535050	Title issued or updated - Registration issued or renewed - New owner reported - Loan or lien reported Avoid financial headaches. Make sure the loan has been paid off if you're buying from a private seller. Learn More

Have Questions? Consumers, please visit our Help Center at www.carfax.com. Dealers or Subscribers, please visit our Help Center at www.carfaxonline.com.



Glossary

Accident Indicator

CARFAX receives information about accidents in all 50 states, the District of Columbia and Canada.

Not every accident is reported to CARFAX. As details about the accident become available, those additional details are added to the CARFAX Vehicle History Report. CARFAX recommends that you have this vehicle inspected by a qualified mechanic.

- According to the National Safety Council, Injury Facts, 2021 edition, 5% of the 276 million registered vehicles in the U.S. were involved in an accident in 2019. Over 77% of these were considered minor or moderate.
- This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 5/24/26 at 11:05:00 AM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

Damage Severity

Damage events result in one of the following severity levels:

- Minor: Generally, minor damage is cosmetic (including dents or scratches), may only require reconditioning, and typically does not compromise a vehicle's operation and/or safety.
- Moderate: Moderate damage may affect multiple components of the vehicle and may impair the vehicle's operation and/or safety.
- Severe: Severe damage usually affects multiple components of the vehicle and is likely to compromise the vehicle's operation and/or safety.

CARFAX recommends getting a pre-purchase inspection at a certified collision repair facility.

First Owner

When the first owner(s) obtains a title from a Department of Motor Vehicles as proof of ownership.

New Owner Reported

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

Ownership History

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

Reliability Forecast

The CARFAX 3-Year Reliability Forecast predicts the likelihood of repairs for a vehicle over the next three years. This forecast is based on vehicles of the same year, make, and model with similar mileage, damage, service history, and other factors, and assumes an average of 15,000 miles driven per year. Repairs are separate from regular maintenance, such as oil changes. Some of the repairs predicted may be covered under warranty. The 3-Year Reliability Forecast is based on data reported to Carfax and is only a prediction, not a guarantee.

Title Issued

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us:  facebook.com/CARFAX  [@CARFAXinc](https://twitter.com/CARFAXinc)  [About CARFAX](#)

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.
© 2026 CARFAX, Inc., part of S&P Global. All rights reserved.
5/24/26 11:05:00 AM (CDT)

I have reviewed and received a copy of the CARFAX Vehicle History Report for this 2017 HONDA CR-V vehicle (VIN: 7FARW5H3XHE006150), which is based on information supplied to CARFAX and available as of 5/24/26 at 12:05 PM (EDT).

Customer Signature	Date	Dealer Signature	Date
--------------------	------	------------------	------

